## Sedgwick County, Kansas – EMS Post #14 Americans with Disabilities Act Transition Plan

(4030 N. Reed - Maize)

## December 2006



Prepared by

## **DMCG**

Disability Management Consulting Group L.L.C. (dba; ADA Accrediting and Consulting)
2801 Jonquil Place
Columbia, MO 65202

In conjunction with

Sedgwick County and the Wichita/Sedgwick County Access Advisory Board

**Sedgwick County – ADA/504 Transition Plan – EMS Post #14 - December 2006** 

Legend: Blue font identifies hyperlinked documents – Red font indicates recommended changes to structures or policies

Locations	Structural Inconsistencies		Recommended Corrections/Modifications to Ensure Program Access	Criteria – L=low, M=medium, H=high				ental Technical formation	Finalized Actions			
Location	Identified Issue	ADAAG Specifications	Recommended Correction	Priority (overall)	Public Access	Frequency - PWD	Photo #	Conceptual Costs	Support Information	Finalized Correction	Date to be Corrected	Date Completed (Include initial)
1. Parking	At the time of the on-site survey, this facility was still under construction. At this time no parking spaces were designated as accessible.	4.1.2( 5)(a), (b), 4.6	If parking spaces are provided for self-parking by employees or visitors, or both, then accessible spaces complying with 4.6 shall be provided in each such parking area in conformance with the table shown in (5)(a). In addition, one in every eight accessible spaces, but not less than one, shall be served by an access aisle 96 in (2440 mm) wide minimum and shall be designated "van accessible." Ensure that at least one van accessible parking space exists, which conforms to ADAAG specifications.	V H	L	M	7	\$0?	(See Building Block 1 – Accessible Parking, for greater clarification).			
2. Interior – Drinking Fountain	A hi-lo drinking fountain does not exist.	4.15 4.1.3( 10(a)	According to ADAAG if only one drinking fountain is provided on a floor there shall be a drinking fountain which is accessible to individuals who use wheelchairs and one accessible to those who have difficulty bending or stooping. Ensure that at least one set of hilo drinking fountains exist in this facility.	V H	L	M	1	\$2,500	Building Block 7 – Drinking Fountains			
3. Men's Restroom	The water closet is centered at 17.5-inches.	4.16	According to ADAAG, accessible water closets must be centered at 18-inches from the sidewall. Even though ADAAG requires that water closets be centered at 18-inches, absolute, local building and construction practices may allow ½-inch deviation for the centering of water closets from sidewalls. Examine local building and construction tolerances to determine whether or not this water closet will need to be modified.	V H	L	M	<u>5</u>	\$0?	See Building Block 9 – Accessible Restrooms, for more information			
	The women's restroom and all other features of this facility were fully accessible complying with ADAAG.											

EMS Post #14 - Transition Plan - Conceptual Cost Projections

_Total	\$2,500+_
Year One (Very High – VH)	\$2,500+
Year Three (High - H)	<b>\$0</b>
Year Five (Medium - M)	<b>\$0</b>
Year Ten (Low - L)	<b>\$0</b>
Year Ten (Very Low - VL)	<u> </u>