


**Sedgwick County, Kansas – Public Works, Noxious Weed
Americans with Disabilities Act Transition Plan
(901 Stillwell)**

December 2006

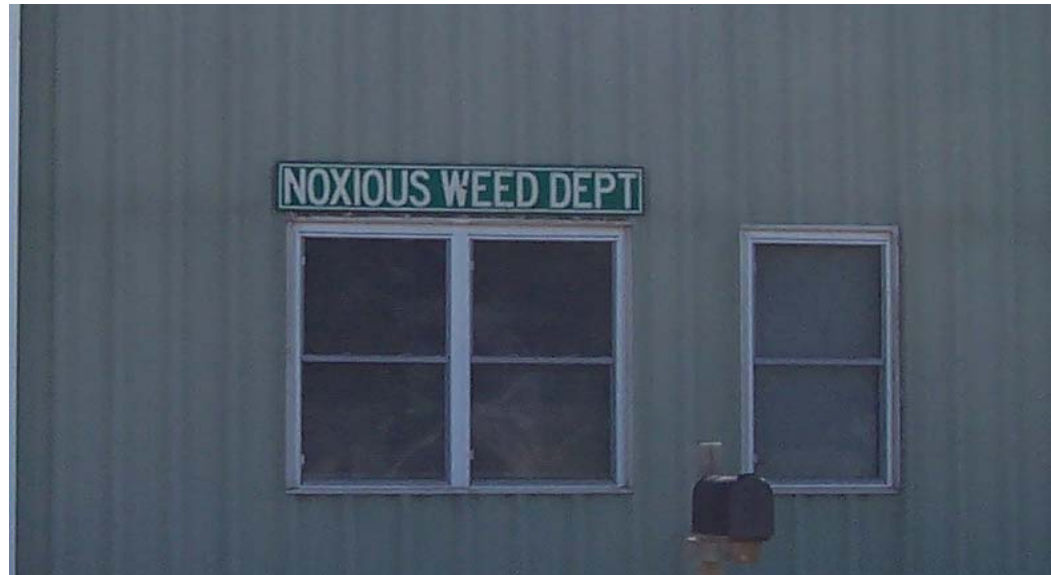

Prepared by

DMCG
Disability Management Consulting Group L.L.C.
(dba; ADA Accrediting and Consulting)
2801 Jonquil Place
Columbia, MO 65202

In conjunction with

Sedgwick County and the Wichita/Sedgwick County Access Advisory Board

Sedgwick County – ADA/504 Transition Plan – Public Works, Noxious Weed - December 2006

Legend: **Blue** font identifies hyperlinked documents – **Red** font indicates recommended changes to structures or policies

Locations		Structural Inconsistencies		Recommended Corrections/Modifications to Ensure Program Access			Criteria – L=low, M=medium, H=high			Supplemental Technical Information			Finalized Actions		
Location	Identified Issue	ADAAG Specifications	Recommended Correction	Priority (overall)	Public Access	Frequency - PWD	Photo #	Conceptual Costs	Support Information	Finalized Correction	Date to be Corrected	Date Completed (Include initial)			
1. Parking	Designated accessible parking does not exist.	4.1.2(5)(a) , (b) , 4.6	If parking spaces are provided for self-parking by employees or visitors, or both, then accessible spaces complying with 4.6 shall be provided in each such parking area in conformance with the table shown in (5)(a) . In addition, ADAAG requires one in every eight accessible spaces, but not less than one, to be served by an access aisle 96 in (2440 mm) wide minimum and to be designated "van accessible." If this facility is open to the public and parking is made available to the public, provide one van accessible parking space located on an accessible route to the entrance. If restriping occurs, ensure that it meets Wichita city code. Note: Wichita city code requires all accessible parking spaces to be 11' wide with a 5' aisle for a total of 16'. ADAAG recognizes these dimensions as universal design.	L	L	M	50	\$1,000	(See Building Block 1 – Accessible Parking , for greater clarification).						
2. Entrance	The ramp, leading to the entrance, does not provide handrails on both sides and does not provide edge protection.	4.8	According to ADAAG, any part of an accessible route with a slope greater than 1:20 shall be considered a ramp. If a ramp run has a rise greater than 6-inches or a horizontal projection greater than 72-inches, then it shall have handrails on both sides. In addition, ramps and landings with drop-offs shall have curbs, walls, railings, or projecting surfaces that prevent people from slipping off the ramp. Curbs shall be a minimum of 2 in (50 mm) high (see Fig. 17). Provide handrails on both sides of this ramp, including edge protection to keep individuals from slipping off.	M	L	M	51	\$750	See Building Block 3 – Ramps , for more information						
3. Interior	The public counter is located too high at 42-inches.	7.2(2)	At counters where goods and services are distributed, but do not include cash registers, either a portion of the counter is required to be accessible or an accessible lowered counter or desk should exist in close proximity to the counter. Accessible counters are a maximum of 36-inches high and a minimum of 36-inches long. Ensure that a desk in close proximity to the counter is available and can be utilized when necessary.	L	L	M	60	\$500	ADAAG New ADAAG						

Photo Folder “Sedgwick Photos – On-site Surveys – Zoo Correction Coliseum”

Sedgwick County – ADA/504 Transition Plan – Public Works, Noxious Weed - December 2006

Legend: **Blue** font identifies hyperlinked documents – **Red** font indicates recommended changes to structures or policies

Locations	Structural Inconsistencies		Recommended Corrections/Modifications to Ensure Program Access	Criteria – L=low, M=medium, H=high			Supplemental Technical Information			Finalized Actions		
Location	Identified Issue	ADAAG Specifications	Recommended Correction	Priority (overall)	Public Access	Frequency - PWD	Photo #	Conceptual Costs	Support Information	Finalized Correction	Date to be Corrected	Date Completed (Include initial)
4. Interior	Both the men’s and women’s restrooms are totally inaccessible due to numerous inconsistencies.	4.23	Inconsistencies include, but are not limited to, narrow stalls, pipes exposed under lavatories, no rear grab bars and short side grab bars, mirrors are located too high, entrance door signs not in Braille, toilet seats too low, toilets not centered at 18-inches, totally inaccessible showers, etc. In new construction, ADAAG requires all public restrooms to be fully accessible. However, this facility is not considered new construction, and therefore falls under the program access provisions of Title II. Each and every public restroom may not need to be made accessible according to program access. If restrooms are made available for use by the public, we recommend creating one fully accessible unisex restroom.	L	L	M	5 2 5 3 5 5 5 6	\$8,000	See Building Block 9 – Accessible Restrooms , for more information			

Public Works, Noxious Weed Department - Transition Plan - Conceptual Cost Projections

Total	\$10,250
Year One (Very High - VH)	\$0
Year Three (High - H)	\$0
Year Five (Medium - M)	\$750
Year Ten (Low - L)	\$9,500
Year Ten (Very Low - VL)	\$0